



INTERNATIONAL ROAD DYNAMICS INC.

702 - 43rd Street East Saskatoon, SK CANADA S7K 3T9

Ph: (306) 653-6600 Fax: (306) 242-5599 www.irdinc.com

- Site Report -

Date: June 9, 2009

IRD Sales Order: 10407L

To: Ray Pollon

From: Shawn Brown, Bruce Myers, Cindy Matie

Project Name/Location: Little Rock LTPP (AR) / I-30 Mile Post 101.8

Service Date(s): July 29th, 2008

Weather: Sunny, clear, 102F Temp

Job Description:

- Performed routine site maintenance
- Installed rubber strips to clamping.

Work Completed:

- Removed clamping bar and installed thicker rubber strips
- Installed new spring discs and nuts
- Torqued nuts to required spec.
- Installed new temperature sensor with 300' lead and pull up resistor
- Completed site maintenance log

Work Remaining:

Short lead temperature sensor was left terminated. Engineering will work to determine issues with long sensor lead as it was unable to communicate with this sensor. Short lead (~4ft) was left coiled inside cabinet. Pull up resistor left unterminated as 300' lead failed to work correctly.

Schedule Include Estimate to Complete (on-track, ahead, behind):

- On-track

Parts Used:

Item Number	Description	Quantity
PT302846	Rubber Strip 1.75m Retaining Bar	X 4
PT302572	Disc Spring M12 DIN 6796 ST ZY	X 25
116005	Nut Stover Lock 1/2-20 L9 ZY	X 25
340164	UC SILICONE RTV SU5007CLEAR 10.3 FL. OZ.	X 2
170695-03	Temp Snsr In-Rd +/-0.5 DegC 1-Wire PE 300'Ld x1	
190574	Kit iSINC Temp Sens Ext Pull-up Res Cable x1	

Pre-mature Equipment Failure:



INTERNATIONAL ROAD DYNAMICS INC.

702 - 43rd Street East Saskatoon, SK CANADA S7K 3T9

Ph: (306) 653-6600 Fax: (306) 242-5599 www.irdinc.com

- None

Mileage / Travel Time:

- 460 miles / 7.5 Hrs (one way)

Safety Concerns:

- None noted

Issues Related to Sub-Contractors:

- None

Other Notes:

Action Items:


Item	Action Required	Ownership
1.	Temp sensor with long lead length issues	ENG
2.		
3.		
4.		



INTERNATIONAL ROAD DYNAMICS INC.

702 - 43rd Street East Saskatoon, SK CANADA S7K 3T9

Ph: (306) 653-6600 Fax: (306) 242-5599 www.irdinc.com

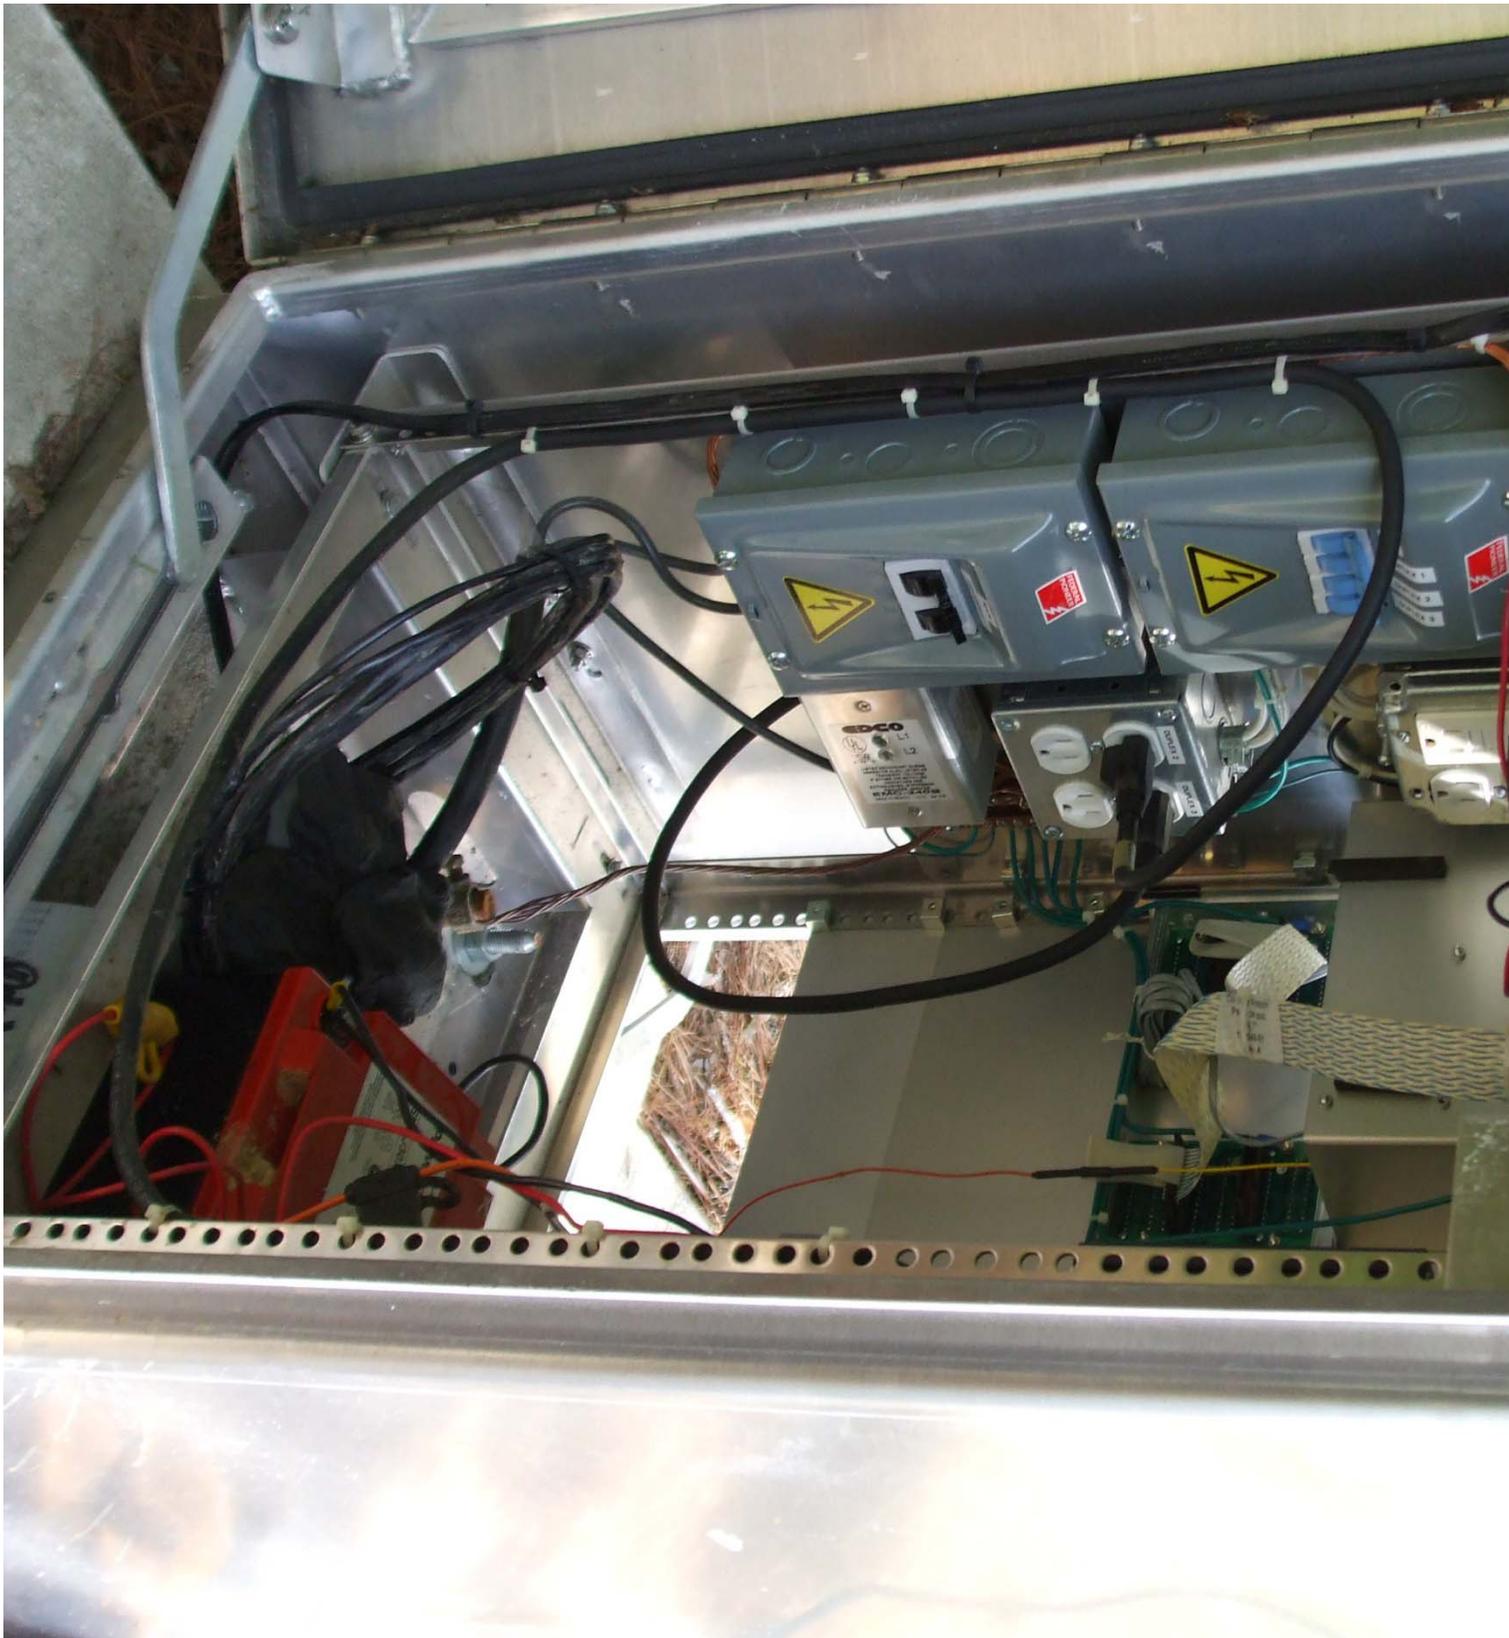



INTERNATIONAL ROAD DYNAMICS INC.

702 - 43rd Street East Saskatoon, SK CANADA S7K 3T9

Ph: (306) 653-6600 Fax: (306) 242-5599 www.irdinc.com





INTERNATIONAL ROAD DYNAMICS INC.

702 - 43rd Street East Saskatoon, SK CANADA S7K 3T9

Ph: (306) 653-6600 Fax: (306) 242-5599 www.irdinc.com






INTERNATIONAL ROAD DYNAMICS INC.

702 - 43rd Street East Saskatoon, SK CANADA S7K 3T9

Ph: (306) 653-6600 Fax: (306) 242-5599 www.irdinc.com

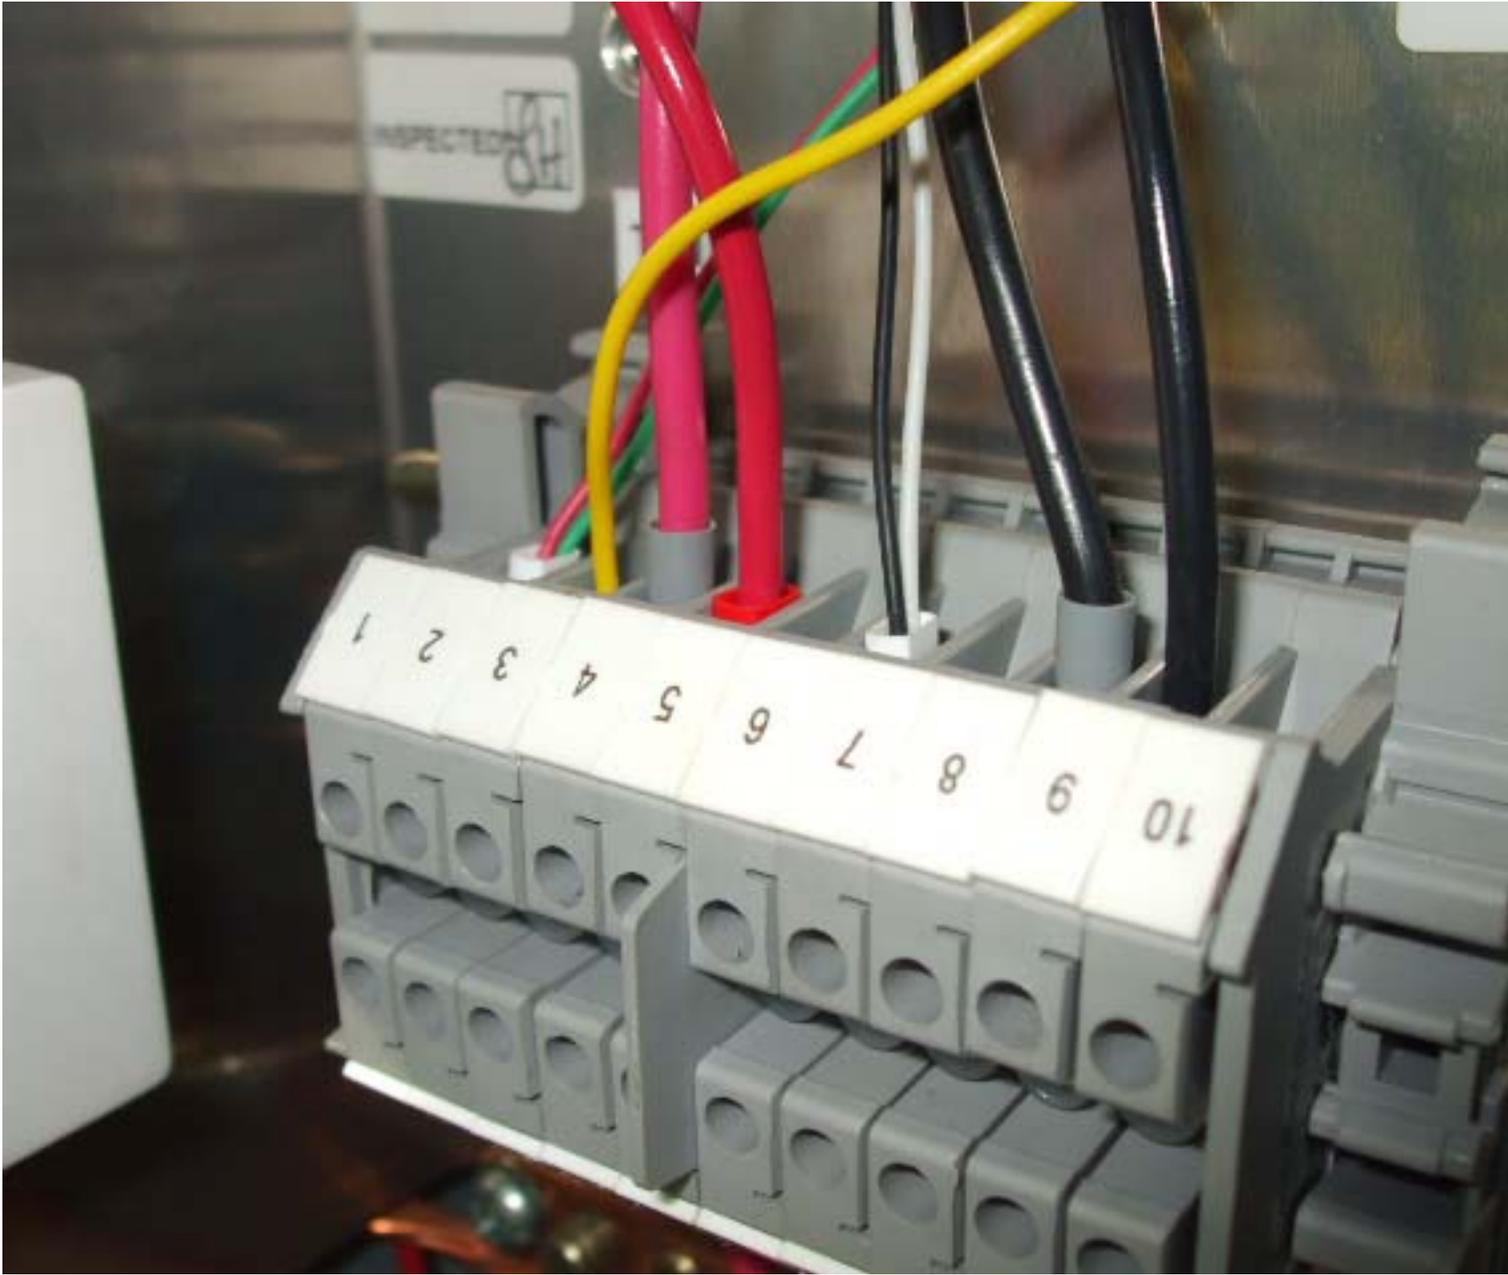




INTERNATIONAL ROAD DYNAMICS INC.

702 - 43rd Street East Saskatoon, SK CANADA S7K 3T9

Ph: (306) 653-6600 Fax: (306) 242-5599 www.irdinc.com

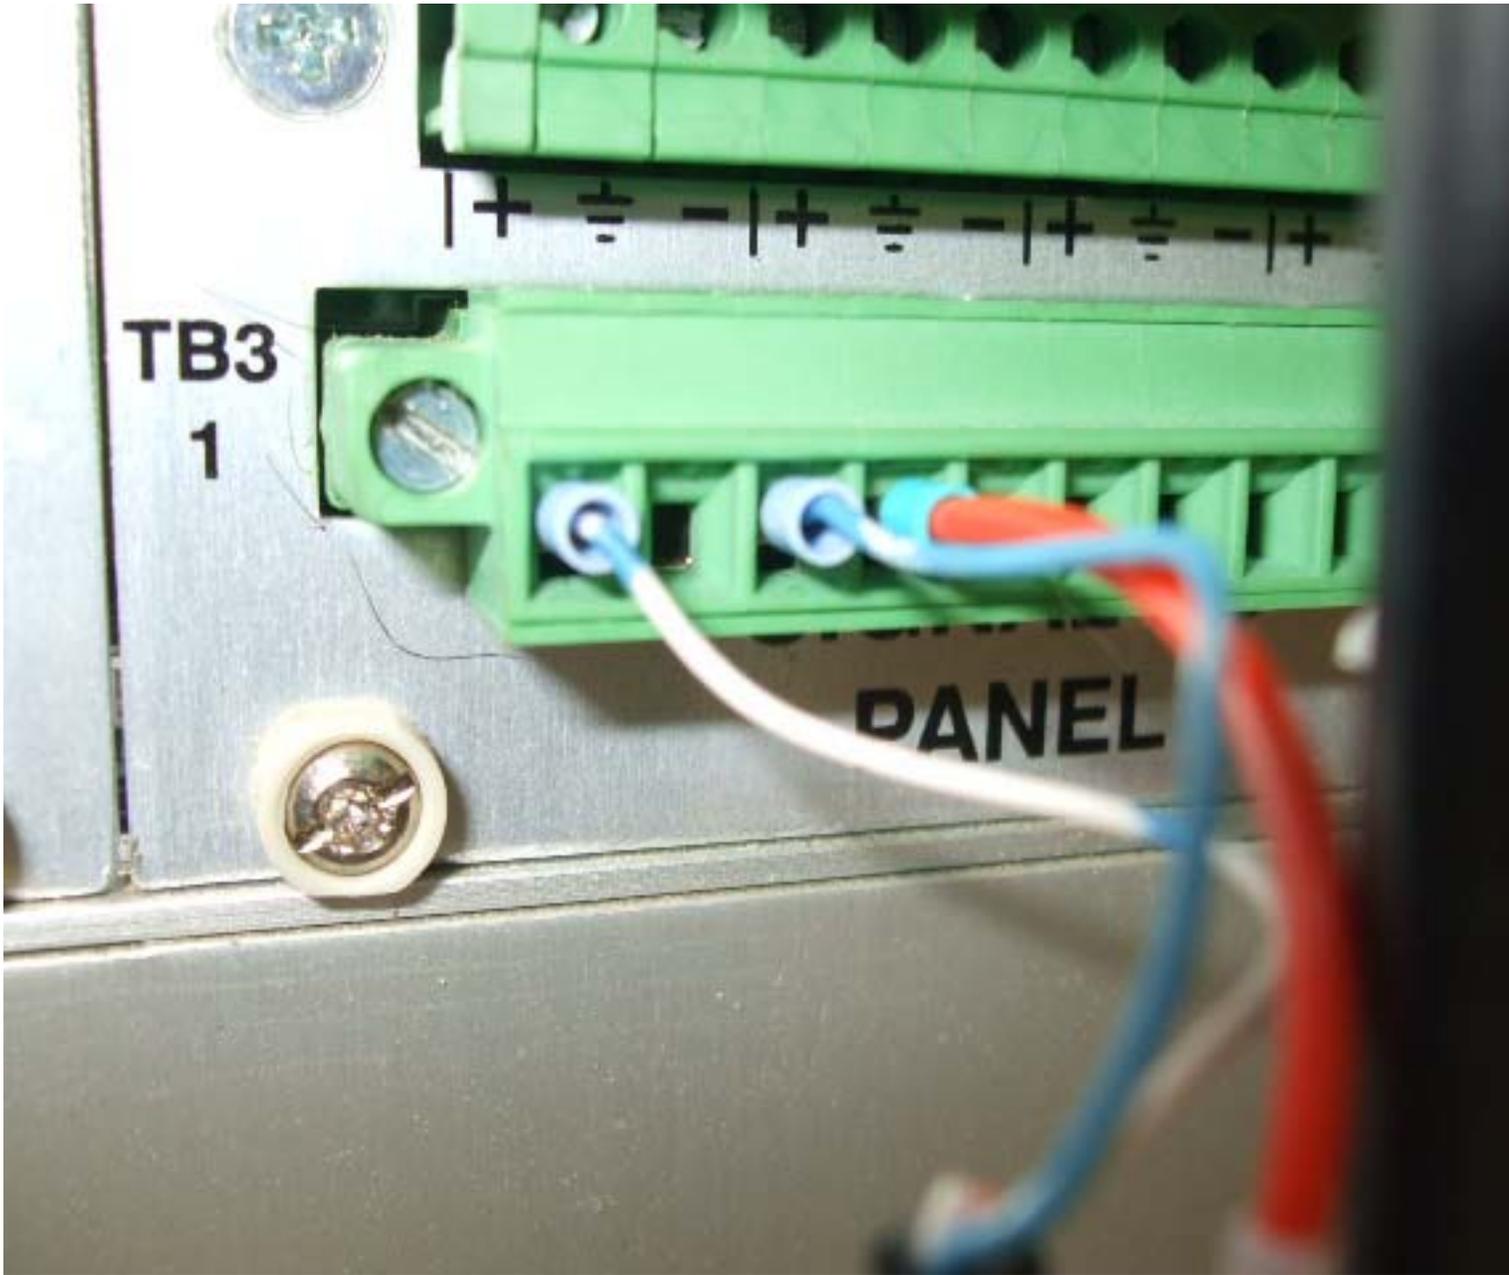



INTERNATIONAL ROAD DYNAMICS INC.

702 - 43rd Street East Saskatoon, SK CANADA S7K 3T9

Ph: (306) 653-6600 Fax: (306) 242-5599 www.irdinc.com





INTERNATIONAL ROAD DYNAMICS INC.

702 - 43rd Street East Saskatoon, SK CANADA S7K 3T9

Ph: (306) 653-6600 Fax: (306) 242-5599 www.irdinc.com





INTERNATIONAL ROAD DYNAMICS INC.

702 - 43rd Street East Saskatoon, SK CANADA S7K 3T9

Ph: (306) 653-6600 Fax: (306) 242-5599 www.irdinc.com





INTERNATIONAL ROAD DYNAMICS INC.

702 - 43rd Street East Saskatoon, SK CANADA S7K 3T9

Ph: (306) 653-6600 Fax: (306) 242-5599 www.irdinc.com





INTERNATIONAL ROAD DYNAMICS INC.

702 - 43rd Street East Saskatoon, SK CANADA S7K 3T9

Ph: (306) 653-6600 Fax: (306) 242-5599 www.irdinc.com





INTERNATIONAL ROAD DYNAMICS INC.

702 - 43rd Street East Saskatoon, SK CANADA S7K 3T9

Ph: (306) 653-6600 Fax: (306) 242-5599 www.irdinc.com





INTERNATIONAL ROAD DYNAMICS INC.

702 - 43rd Street East Saskatoon, SK CANADA S7K 3T9

Ph: (306) 653-6600 Fax: (306) 242-5599 www.irdinc.com

